

TOYOTA

SERVICE BULLETIN

TOYOTA MOTOR SALES, U.S.A., INC.

VOLUME

9

REFERENCE AUDIO
NUMBER 004
DATE 02-19-88
MODEL AE, ST, SV, YR

Page 1 of 1

NO ILLUMINATION ON CASSETTE DECK

SYMPTOM: No illumination on '87 model vehicles when used in conjunction with the following '88 cassette decks:

<u>Deck Type</u>	<u>P/N</u>	<u>Model</u>
Standard Deck	08690-00801	1921
Premium Deck	86260-29175	1919

CAUSE: The sub-assembly DIN connector wire (P/N 08689-00802) is missing the ground wire connector.

CORRECTION: Replace the sub-assembly DIN connector wire with improved wire which incorporates a white tape marking on the cord. The part number (P/N 08689-00802) remains the same.

