

TOYOTA

SERVICE BULLETIN

TOYOTA MOTOR SALES, U.S.A., INC.

VOLUME

10

REFERENCE AUDIO
NUMBER 005
DATE 04-14-89
MODEL '88 & 89, VV


Page 1 of 1

'89 ELECTRONIC TUNE RADIO COMBO ALTERNATOR WHINE NOISE

CONDITION: Alternator whine noise may occur in '88 or '89 Camry V-6 with an '89 ETR Combo 4 speaker model 2632 Fujitsu Ten (P/N 86120-19165) installed. This noise will be most noticeable during headlamp operation when playing a cassette tape at low volume listening.

CAUSE: Illumination main power wire static noise from headlamp circuit.

CORRECTION: Install a sub-wire noise suppressor adaptor in-line between the radio unit and the vehicle wire harness as shown below:

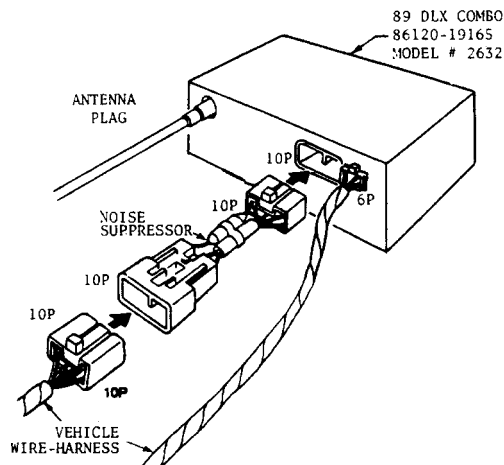

Please contact **Fujitsu Ten Service Center parts department** for noise suppressor.

California 1-800-222-9270

West Nationwide: 1-800-237-5413

East Nationwide: 1-800-451-4698

NOTE: Toyota Service Bulletin (TSB) Audio #004 dated 03-10-89 has been superseded by this bulletin. Please remove and discard TSB Audio #004 dated 03-10-89, and replace with TSB AUDIO #005.