

TOYOTA

SERVICE BULLETIN

TOYOTA MOTOR SALES, U.S.A., INC.

VOLUME

10

REFERENCE ELECTRICAL

NUMBER 016

DATE 12-28-90

MODEL ALL


Page 1 of 2

1990 FUJITSU TEN CD PLAYERS SCRATCHING CD'S

The following 1990 model Fujitsu Ten CD players may exhibit scratching of CD's during insertion or ejection:

<u>Model:</u>	<u>Part Number:</u>	<u>Application:</u>
34201	08601-00801	PIO/DIO CD Player
14201	86270-14051	Factory Installed CD Player on 1990 Supra/Celica
14202	86270-95D00	Factory Installed CD Player on 1991 Previa

If the scratches occur, they will typically be straight and about 1-2 inches long on the label of playing surface of the CD as shown:

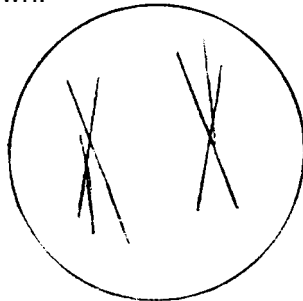

PRODUCTION CHANGE:

Fujitsu Ten has made the following production improvements to prevent this condition from occurring:

- Design change of transport mechanism.
- Prevention of foreign material contamination of the CD's transport mechanism.
- Cleaning of transport mechanism.

CD Player	P/N	From Serial Number	CD Units Production Date
34201	08601-00801	5600000	10/89
14201	86270-14051	5600000	10/89
14202	86270-95D00	5600000	10/89

1990 FUJITSU TEN CD PLAYERS SCRATCHING CD'S (CONT'D)

IDENTIFICATION PROCEDURE:

The following procedure can be used to identify improved units:

- Remanufactured CD players with the production change will have a 1/2 inch round brown sticker on the top cover (see current remanufactured inventory has been modified).
- CD Players with the production change incorporated at the factory will either have a 1/4 inch green dot next to the serial number or have a serial number above 5600000. (CD Players with serial numbers above 5600000 will not have the 1/4 inch dot.)

SHIPPING INSTRUCTIONS:

When shipping the CD Players, insert the shipping screw to prevent damage to the CD Player as illustrated below:

