




TECHNICAL SERVICE BULLETIN

REF.: AUDIO
NO.: AU92-001
DATE: JANUARY 17, 1992
MODEL: ALL MODELS

1991 PIO/DIO AUDIO 11201/74100 CUTS OUT DURING CASSETTE MODE

Page 1 of 1

Sound intermittently "cuts out" cassette mode on 1991 vehicles equipped with 11201 PIO/DIO 2 speaker ETR radio and 74100 PIO/DIO cassette player combination. This condition occurs most frequently in cold and dry climates.

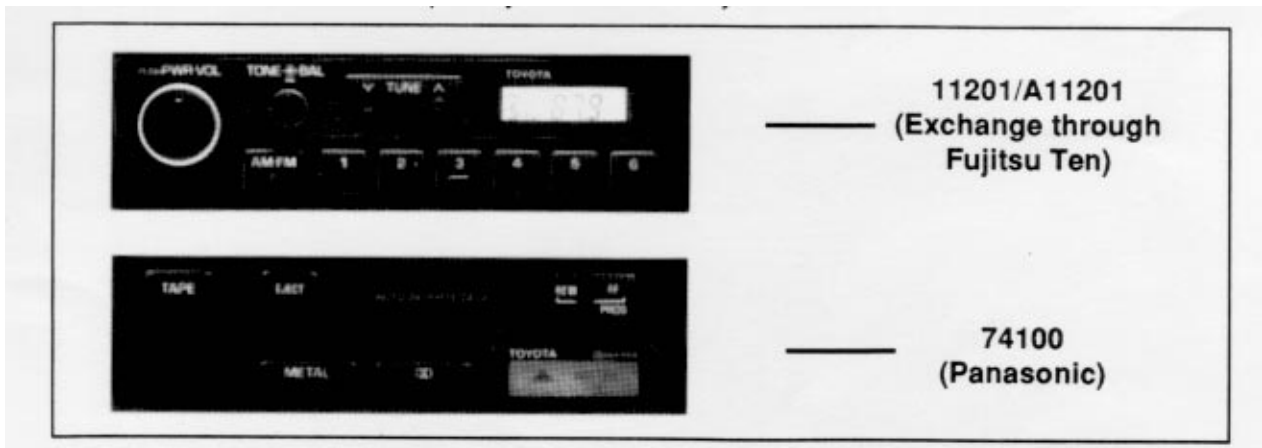

PART NUMBER INFORMATION:

MODEL	DESCRIPTION	MANUFACTURER	PART NO.
11201	2 Speaker ETR	Fujitsu Ten	86120-16651
A11201	"	"	86120-19185
74100	Cassette Player	Panasonic	08690-00818

SERVICE PROCEDURE:

Exchange the 11201 2 speaker ETR through Fujitsu Ten's warranty exchange program. All exchange radios have been countermeasured effective 11/06/91. Countermeasured 11201 radios will have a "black" mark on the volume shaft (remove the volume knob to verify marking).

NOTICE:

Countermeasure is effective **only** when sound intermittently "cuts out" during cassette mode with the 11201/74100 combination. If the cassette player has no sound, check the "D/P" switch to make sure it is set in the "P" position.

TOYOTA MOTOR SALES U.S.A., INC.