



# TECHNICAL SERVICE BULLETIN

**REF.:** AUDIO  
**NO.:** AU92-004  
**DATE:** AUGUST 21, 1992  
**MODEL:** ALL MODELS


## CD INOPERATIVE ON '92 PANASONIC 3-IN-1 RADIOS (56804 & 56801)

Page 1 of 2

CD won't play or CD skipping conditions may occur on 3-in-1 radios 56804 (P/N 86120-33100) and 56801 (P/N 86120-2A022). This can be caused by the following:

- 1) Optical lens of the CD changer deforms with high temperature.
- 2) Guide pins contact the CD during play.

**56801  
(CRESSIDA ONLY)**

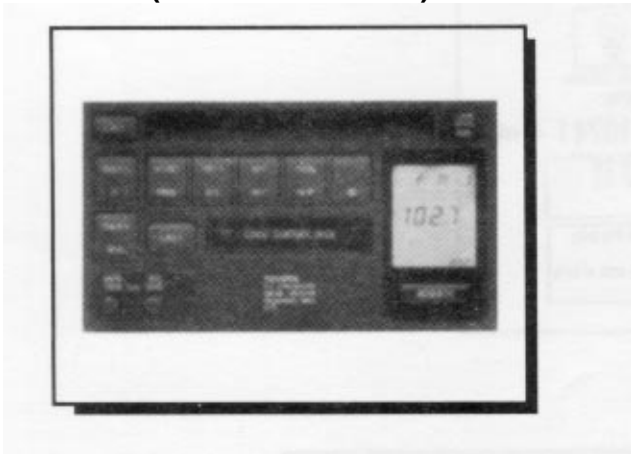

**56804**



### **DIAGNOSTIC TIPS:**

- 1) Check that the playing surface of the CD is free of oil, dust and scratches. Also check the edge of the CD for small pieces of loose plastic which may flake off onto the playing surface. When cleaning a CD, wipe off foreign material in a straight line, center-to edge (non-circular) motion.
- 2) Confirm that the customer is not driving on excessively rough roads.

TOYOTA MOTOR SALES U.S.A., INC.


**PRODUCTION CHANGE INFORMATION:**

Production change has been made by Panasonic to the CD player's optical pick-up and guide pins starting 12/91 (vehicle production date).

Model Number	Part Number	Starting Audio Chassis Serial Number
56804	86120-33100	200001 -
56801	86120-2A022	200001 - (Cressida Only)

**EXCHANGE UNIT INFORMATION:**

Exchange units have been countermeasured starting 2/92 and can be identified by a **GREEN DOT** next to the serial number on the ID label.

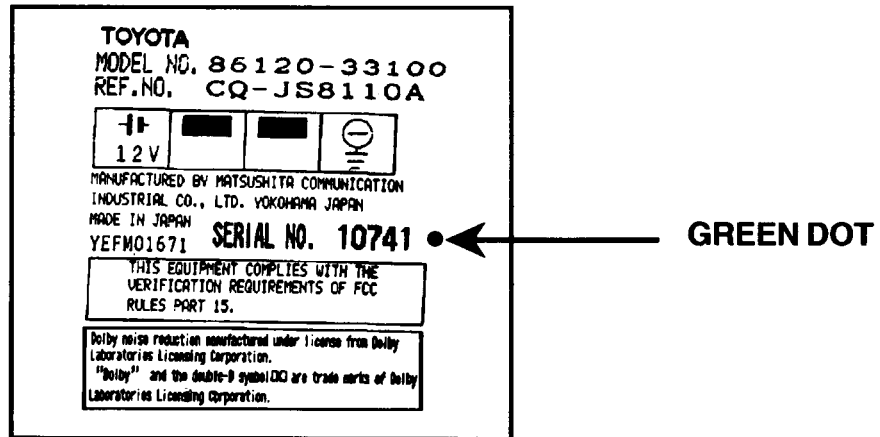

**RETURN EXCHANGED UNITS AS SOON AS POSSIBLE.**