



TECHNICAL SERVICE BULLETIN


REF.: AUDIO
NO.: AU94-002
DATE: SEPTEMBER 16, 1994
MODEL: ST, AT

'94 CELICA 11708 AND 16804 PREMIUM RADIO ILLUMINATION

Page 1 of 2

The Fujitsu Ten radio amplifiers (P/N 86280-20400 6-speaker amplifier or P/N 86280-20370 8-speaker amplifier) on '94 Celicas have been modified so the radio illumination dims at the same rate as the instrument panel illumination when the dimmer rheostat is used with the headlights "ON."

Only Celicas with the 11708 Premium Combo and 16804 3-in-1 Premium Combo radios are equipped with these amplifiers:

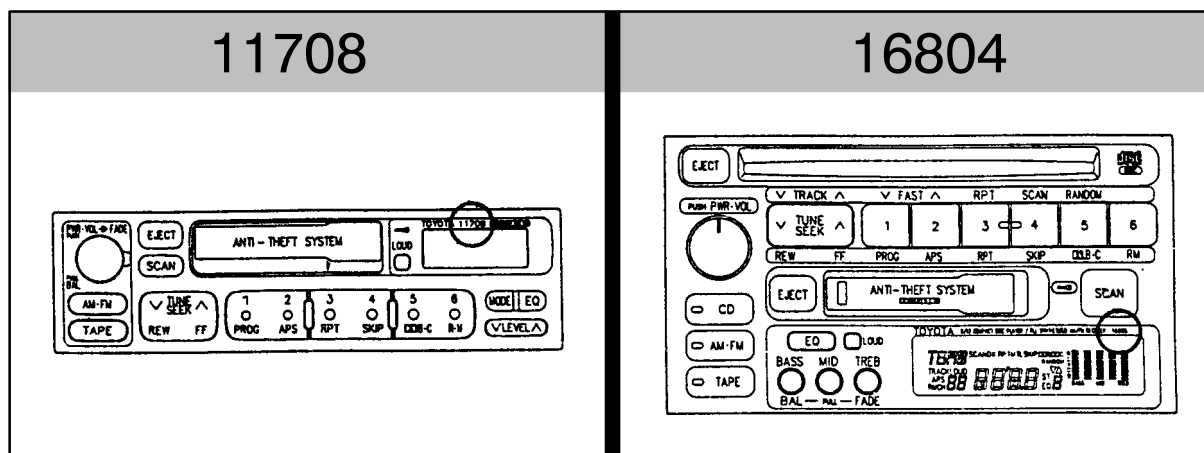

Condition: Illumination of '94 Celicas with 11708 or 16804 Premium Combo radio dims faster than the instrument panel illumination when the illumination rheostat is used with the headlights "ON."

Cause: Incorrect illumination circuit inside the amplifier.

Correction: Exchange the amplifier through Fujitsu Ten.

'94 CELICA 11708 AND 16804 PREMIUM RADIO ILLUMINATION

PRODUCTION CHANGE INFORMATION:

Production change was made starting 2/94 production.

Starting VIN:	Production Date:
JT2ST07NXR0009599	2/94
JT2AT00N1R0017127	2/94

PART NUMBER INFORMATION:

Part numbers have been changed.

Previous Part No.	New Part No.	Part Name
86280-20400	86280-20401	Amplifier Assy, Stereo Component 6-Speaker
86280-20370	86280-20371	Amplifier Assy, Stereo Component 8-Speaker

EXCHANGE UNIT INFORMATION:

Exchange the amplifier through Fujitsu Ten. Countermeasured exchange amplifiers will have a blue dot on the upper left corner of the Part Number label. Fujitsu Ten started shipping countermeasured exchange amplifiers starting 4/94.

