



Technical Service BULLETIN

June 18, 1999

Title: 4RUNNER VSV TICKING NOISE

Models: '98 4Runner

T S B

ENGINE
EG007-99

Introduction To eliminate a “ticking” noise in the cabin of the vehicle in cold temperatures (below 0° F), the hardness of the Vacuum Switching Valve Mount has been changed.


- Affected Vehicles**
- 1998 4Runners produced before the following VINs: JT3GM84R#W0034816
JT3GN8#R#W0088930
JT3HM84R#W0030400
JT3HM84R#W9019740
JT3HN8#R#W0189768
JT3HN8#R#W9017768

Parts Information

| PREVIOUS PART NUMBER | CURRENT PART NUMBER | PART NAME |
|----------------------|---------------------|--|
| 25860-75160 | SAME | Valve Assembly, Vacuum Switching No. 1 |

NOTE:

New parts can be identified by a “4” on the side of the rubber mount.

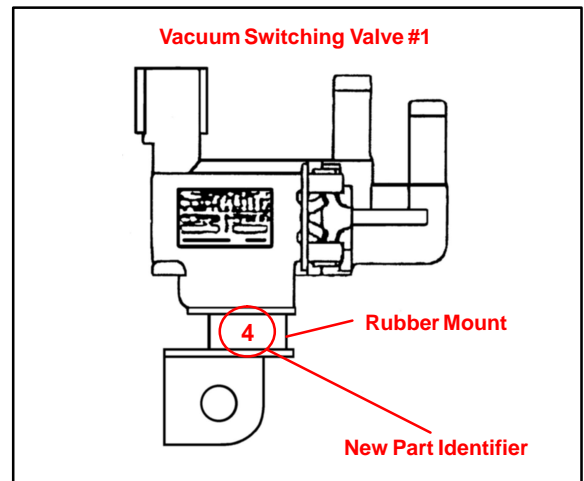

Repair Procedure

Replace VSV No. 1 with part manufactured after countermeasure.

Warranty Information

| OP CODE | DESCRIPTION | TIME | OPN | T1 | T2 |
|---------|------------------------------|------|-------------|----|----|
| 178011 | R & R Vacuum Switching Valve | 0.2 | 25860-75160 | 44 | 18 |

Applicable Warranty*:

This repair is covered under the Toyota Basic Warranty. This warranty is in effect for 36 months or 36,000 miles, whichever occurs first, from the vehicle’s in-service date.

* Warranty application is limited to correction of a problem based upon a customer’s specific complaint.

