

TOYOTA

SERVICE BULLETIN

TOYOTA MOTOR SALES, U.S.A., INC.

VOLUME

10


REFERENCE	TRANSMISSION & CLUTCH
NUMBER	017
DATE	09-29-89
MODEL	SV, ST, AW with A140E

Page 1 of 1

A14#E VALVE BODY STRAINER


When replacing the Valve Body Strainer (P/N 35330-20011) on vehicles equipped with the A14#E A/TM, you may encounter contact between the strainer and the number 1 shift solenoid mounting bolt (see illustration).

This condition does not affect models A130L, A131L, A132L, & A140L (non-ECT A/TM) to which the modified valve body strainer also applies.

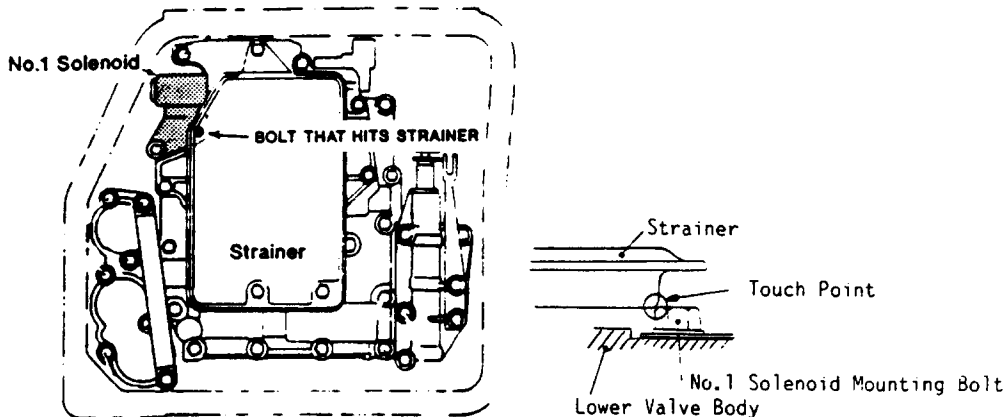

NO.1 SOLENOID MOUNTING BOLT
INTERFERES WITH NEW STRAINER
P/N 35330-20011 INSTALLATION

In order to reduce the contact between the solenoid mounting bolt and the strainer, the head of the bolt must be positioned as shown below.

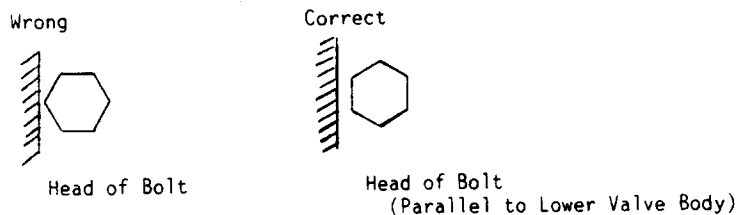

NOTE: A production change to the valve body strainer will be made shortly to eliminate this condition.