

# TOYOTA

## SERVICE BULLETIN

TOYOTA MOTOR SALES, U.S.A., INC.

VOLUME

9

REFERENCE ELECTRICAL

NUMBER 004

DATE 04-01-88

MODEL MX 73

Page 1 of 1

### AIR CONDITIONER CIRCUIT BREAKER OPEN CIRCUIT

**SYMPTON:** When maximum fan blower speed is selected, the air conditioner becomes inoperative.

**CAUSE:** The air conditioner circuit breaker may open irregularly when the blower motor is operated at maximum-high speed after a few minutes. This condition is especially prevalent when the vehicle is parked for several hours in extremely high ambient temperatures.

**CORRECTION:** To prevent the circuit breaker from triggering open, the current capacity of the **cowl wire No. 2** has been increased in length and gauge size.

**New Part #**

82132-22050

**Part Name**

Wire, Cowl No. 2

**Production Change**


From August, 1987

**Frame No.**

MX 73-0136834

**[Location of Cowl Wire No. 2]**

Reverse Side of Junction Block

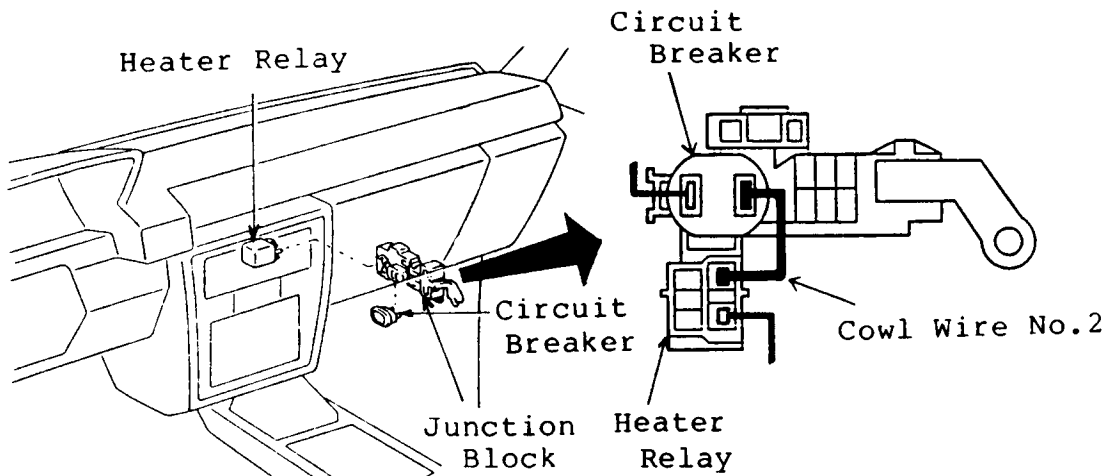

TECHNICAL ASSURANCE DEPARTMENT

EL004-88