




TECHNICAL SERVICE BULLETIN

REF.: BODY
 NO.: BO005-96
 DATE: APRIL 26, 1996
 MODEL: AVL


AVALON SUNVISOR RATTLE NOISE

Page 1 of 2

A rattle noise may be heard from the driver and passenger sunvisors on some 1995 Avalons. To eliminate this condition the sunvisor clip opening size has been decreased in production as follows:

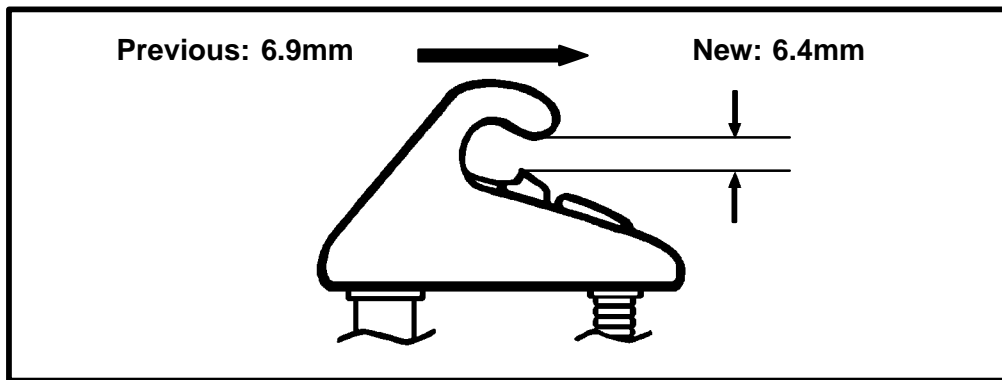

Additionally, felt material was added behind the mirror to provide a tighter fit between the mirror and frame.

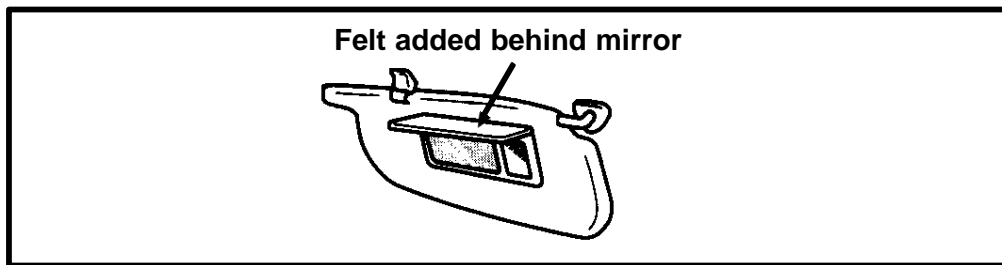

PRODUCTION EFFECTIVE:

Starting VIN: 4T1GB1*E*SU057447 (For reference only)

PART NUMBER INFORMATION:

Previous Part Number	New Part Number	Part Name	Qty.
74348-AC010-XX	Same *	Clip, Sunvisor	2

* The Part number remains unchanged.

FIELD FIX:

To correct this condition, remove the original sunvisor clips and replace them with new ones. If the condition still exists, add felt material behind the mirror to prevent rattle noise.

WARRANTY INFORMATION:

OPCODE	DESCRIPTION	TIME	OPN	T1	T2
752031	Visor Hanger R&R (both)	0.2	74348-AC010-XX	91	43
BD6001	Visor Hanger R&R (both) and installation of felt behind visor mirror	0.3	74310-AC0XX-XX 74320-AC0XX-XX	91	43

