

OBSOLETE

PLEASE SEE NV005-06 (superceding TSB)



Technical Service BULLETIN

March 19, 2003

Title:

FRONT SEAT TRACK SQUEAK

Models:

'03 4Runner

NV001-03

NVH

Introduction Some customers may experience a squeak/creak noise from the front seat track. The following procedure has been developed to reduce this noise.

Applicable Vehicles

- **2003** model year **4Runner** vehicles produced before the VINs listed below.

Production Change Information

MODEL	PLANT	STARTING VIN
4Runner	Tahara (UZN215)	JTEBT17R330016168
	Tahara (UZN210)	JTEZT17RX30009474
	Tahara (GRN215)	JTEBU17R630004335
	Tahara (GRN210)	JTEZU17R730004164
	Hino (UZN215)	JTEBT17R538001124
	Hino (UZN210)	JTEZT17R038000350
	Hino (GRN215)	JTEBU17R538001590
	Hino (GRN210)	JTEZU17R838001744

Parts Information

PREVIOUS PART NUMBER	CURRENT PART NUMBER	PART NAME	QTY
71120-35020	Same	Front Seat Adjuster Sub-Assembly	1

Required Tools & Material

TOOLS & MATERIALS	PART NUMBER	QUANTITY
White Grease	00289-1WG00 (Or Equivalent)	1

Warranty Information

OP CODE	DESCRIPTION	TIME	OFF	T1	T2
BD1063	R & R Seat Track Covers – (1 Seat – 4 Track Covers)	0.1	71120-35020	91	99
Combo A	Apply White Grease to Seat Tracks (8 Apply Areas)	0.3			

Applicable Warranty*:


This repair is covered under the Toyota Comprehensive Warranty. This warranty is in effect for 36 months or 36,000 miles, whichever occurs first, from the vehicle's in-service date.

* Warranty application is limited to correction of a problem based upon a customer's specific complaint.



Repair Procedure


1. Remove seat track covers.

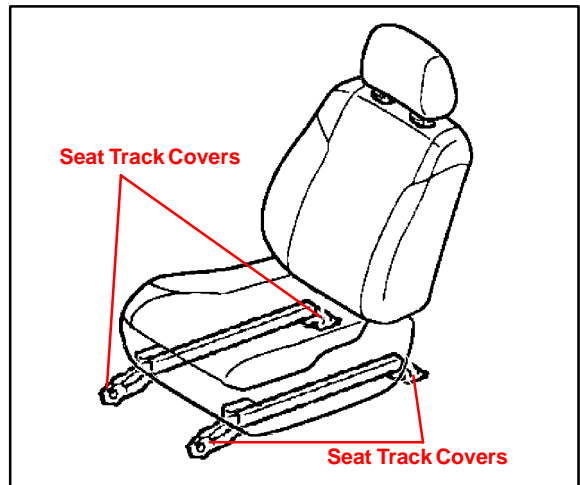

2. Apply white grease between the seat track rail and bracket as shown.

NOTE:

- When applying lubricant to the seat track, cover the carpet with paper or sheet plastic to protect from over spray.
- There are a total of 8 apply areas. Two at the front and two at the rear of each of the two seat tracks.

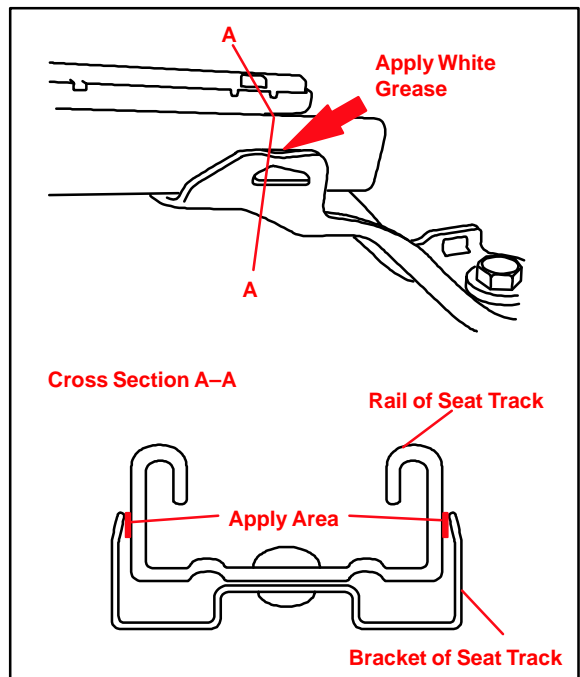

3. Re-install seat track covers.