

TOYOTA

SERVICE BULLETIN

TOYOTA MOTOR SALES, U.S.A., INC.

VOLUME

10

REFERENCE AUDIO
NUMBER 007
DATE 08-04-89
MODEL AE,EL,MA,ST,SV,YR

Page 1 of 2


INOPERATIVE CASSETTE PLAYER

To prevent electrostatic discharge from disabling the cassette player, an aluminum foil sticker has been added to the inside of the face plate assembly. The sticker provides a pathway for the electrostatic discharge originating from a cassette to go directly to the audio chassis and avoid any damage to the printed circuit board and components.

The following are examples of electrostatic damage:

- Tape will not eject.
- Player will not accept tape.
- Tape player is inoperative.

CUTAWAY SIDE VIEW

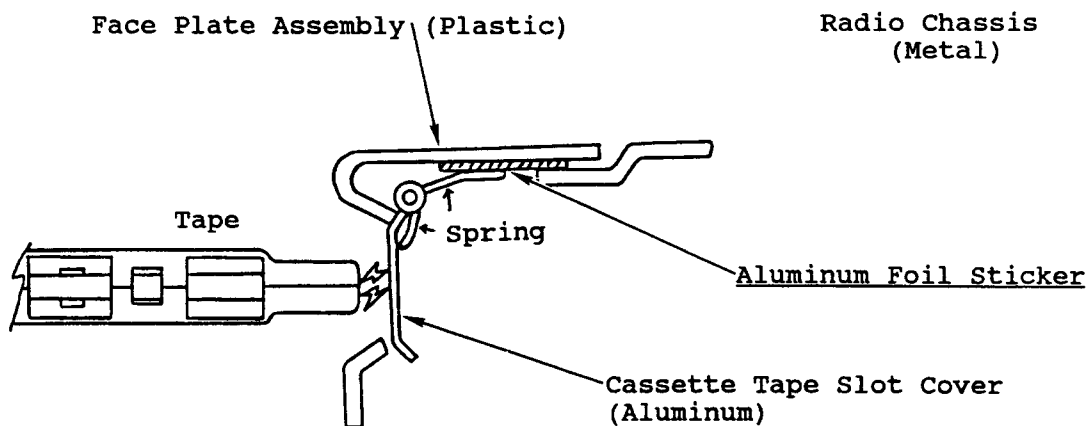

NOTE: If a customer comes in with a tape "stuck" condition, do not attempt to remove the tape. Forcible removal of the tape will damage the tape player mechanism. Instead, contact Fujitsu Ten for a replacement unit and request to have the tape returned.

INOPERATIVE CASSETTE PLAYER (Cont'd)

PRODUCTION EFFECTIVE:

ORIGINAL EQUIPMENT

Part Number	Model	VIN Number	Production Change
86120-12620 " -28050	AE	JT2AE9###K0133145 JT2AE9###K3229501 JT2AE9###K7048885 JT2AE9###K8003813 JT2AE9###K0066494	Jan. '89
86120-12480 " -16560	AE	JT2AE9###K0146507 JT2AE9###K3255128 JT2AE9###K7054163 JT2AE9###K8004116 JT2AE9###K0075595	Mar. '89
86120-16560	EL	JT2EL3###K0409403	Mar. '89
86120-28050	EL	JT2EL3###K0380169	Jan. '89
86120-14760	MA	JT2MA7###K0122164	Jan. '89
86120-14770	MA	JT2MA7###K0126360	Mar. '89
86120-20790 " -20800 " -20810 " -28050	ST	JT2ST6###K7322852 JT2ST68M#K0009021	Jan. '89
86120-03020 " -03030 " -03040	TMM SV	***##*#####	Mar. '89
86120-28050 " -28060	YR	JT3YR2#W#K5054305 JT4YR2#V#K5072461 JT3YR3#W#K0010215 JT4YR34V#K0004096	Jan. '89

EXCHANGE UNIT INFORMATION:

Fujitsu Ten National Service Headquarters (U.S.A) began improvement of exchange units on February 15, 1989.

PART NUMBER INFORMATION:

All Part Numbers remain unchanged.