



TECHNICAL SERVICE BULLETIN

REF.: AUDIO
NO.: AU91-001
DATE: APRIL 26, 1991
MODEL: SW

NOISE ON 1991 MR2 AUDIO SYSTEMS

Page 1 of 2

The alternator has been changed to reduce noise transmitted through the wire harness of the audio system on 1991 MR2. The high pitched noise may be heard in FM/AM, Cassette and CD modes on MR2s equipped as follows:

- With Manual Transmission
- Without Power Steering
- Audio system with separate (remote) Audio Amplifier (see Tech Tip on page 2).

PRODUCTION CHANGE INFORMATION:

<u>FROM VIN</u>	<u>P/D</u>
JT2SW22**M0025286	8/90
JT2SW21**M0007745	8/90

PART NUMBER IDENTIFICATION:

Previous Part Number	New Part Number	Part Name
27060-74160	27060-74170*	Alternator, assy.

* New part is fully interchangeable with pre-production change vehicles.


TECH TIP

The following ETR Combo units have separate audio amplifier:

Model Number	Part Number	Description
56802	86120-17270	2 DIN ETR w/cassette and CD
51702	86120-17260	1 DIN ETR w/cassette (acoustic flavor)
6628	86120-89145	1 DIN ETR w/cassette (acoustic flavor)


DESIGN OF AUDIO UNITS WITH SEPARATE AMPLIFIER

ID Code: 6628 and 51702

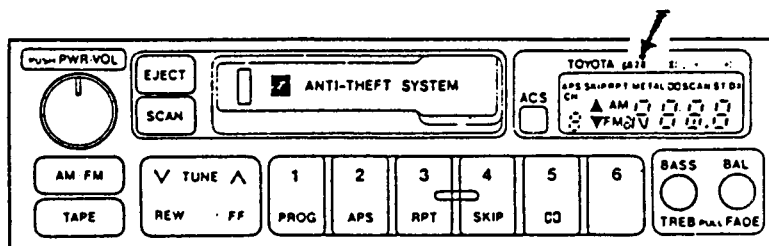

Part Number: 86120-89145
86120-17260

ID Code: 56802

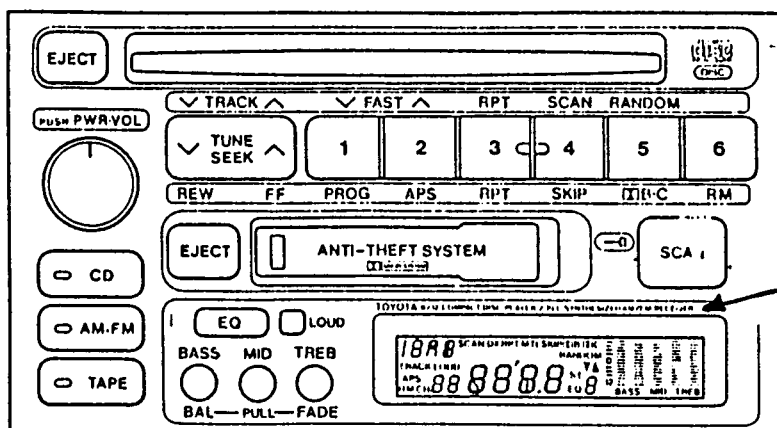

Part Number: 86120-17270