



Technical Service BULLETIN

September 24, 1999

Title: REAR BRAKE SQUEAL NOISE

Models: '98 – '99 Land Cruiser

BR005-99
BRAKES

Introduction To reduce the possibility of squeal noise from the rear brakes the production method of the rear disc brake pad has been changed.

Applicable Vehicles


- 1998 and 1999 Model Year Land Cruiser.

MODEL	STARTING VIN
1998 & 1999 Land Cruiser	JT3HT05J*X0041300

PART NUMBER	PART NAME
04466-60030	Pad Kit, Rear Disc Brake
04946-60030	Shim Kit (if needed*)

* Visually inspect shims for heat discoloration. If discolored, replace.

Repair Procedure Check the production date embossed on the metal backing plate of the brake pads, as shown below. Production dates after 8X29 are effective for eliminating the squeal noise.

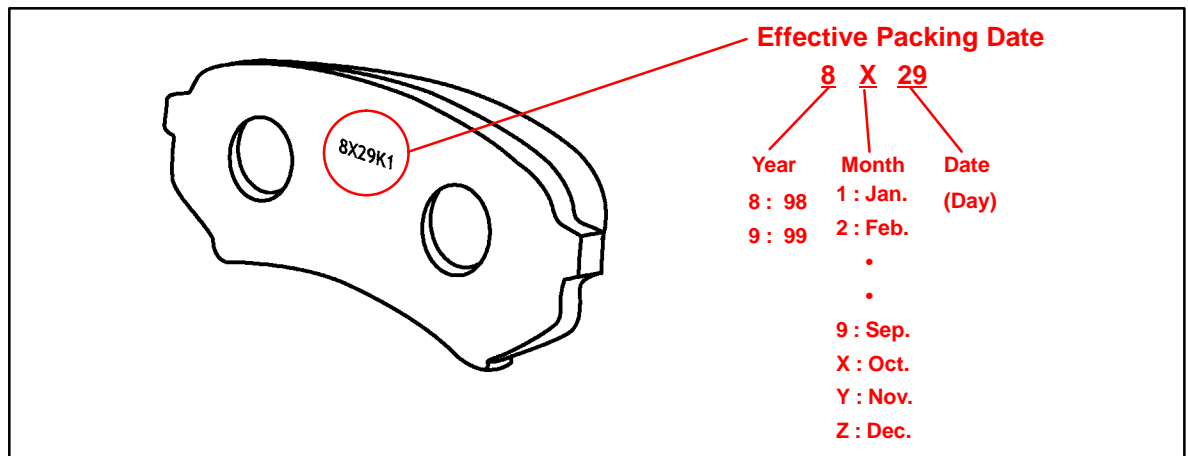

OP CODE	DESCRIPTION	TIME	OPN	T1	T2
473311	R & R Rear Disc Brake Pad and/or Disc Brake Pad Shim (Both Sides)	0.7	04466-60030	36	99

Applicable Warranty*:

This repair is covered under the Toyota Basic Warranty. This warranty is in effect for 36 months or 36,000 miles, whichever occurs first, from the vehicle's in-service date.

* Warranty application is limited to correction of a problem based upon a customer's specific complaint.

