

TOYOTA

SERVICE BULLETIN

TOYOTA MOTOR SALES, U.S.A., INC.

VOLUME


9

REFERENCE AUDIO
NUMBER 003
DATE 02-12-88
MODEL AE

Page 1 of 1

1988 COROLLA COUPE REAR SPEAKER STATIC

CONDITION: Rear speaker static during idle and downshift operation of vehicle.

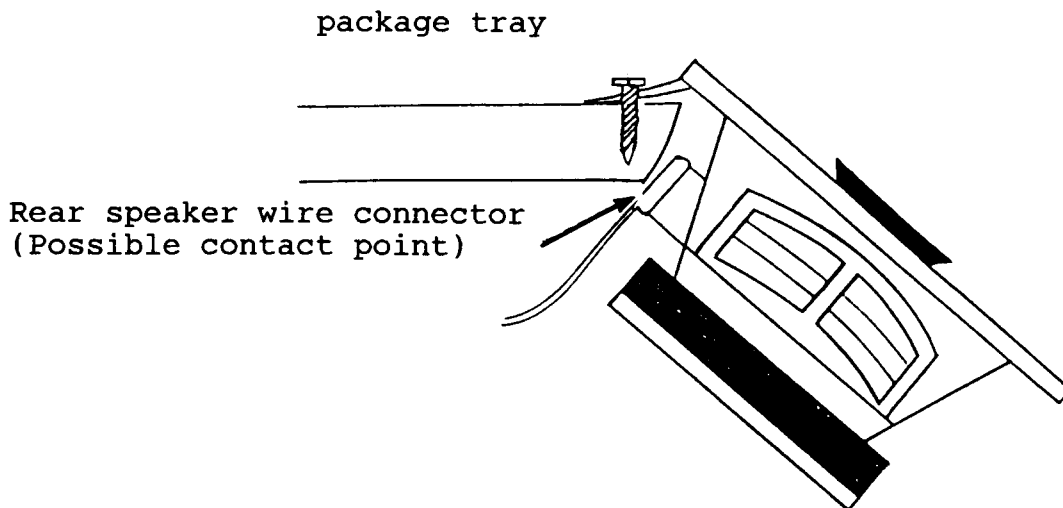

CAUSE: Rear speaker wire connectors may contact rear package tray shelf assembly during idle and downshift.

CORRECTION: Relocate speaker wire connectors by bending connectors away from the package tray and insulate the wire connectors.