



# TECHNICAL SERVICE BULLETIN


REF.: AUDIO  
NO.: AU92-005  
DATE: OCT. 30, 1992  
MODEL: ALL MODELS

## '92 FUJITSU TEN 34210/34212 PIO/DIO CD PLAYER

Page 1 of 2

The CD mechanism has been changed to improve loading/eject operations on the 34210/34212 CD player.

### '92 Fujitsu Ten 34210/34212 PIO/DIO CD Player

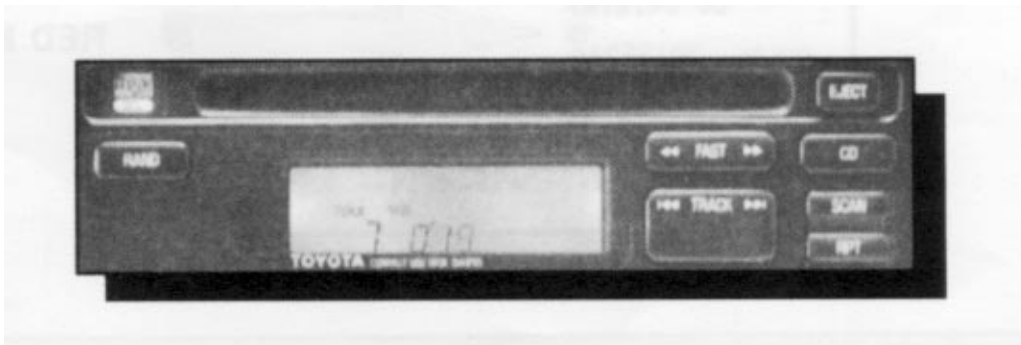

#### **CONDITION:**

CD player will not accept or does not eject CD.

#### **CAUSE:**

Lever in the CD mechanism become misaligned causing the mechanism to jam during loading/eject operations.

#### **CORRECTIONS:**

Exchange the CD player.

#### **PRODUCTION CHANGE INFORMATION:**


Production change was made effective 2/92:

Model Number	Part Number Starting	Serial Number
34210	08601-00812	8500001-
34212 (Previa Only)	08601-00813	8500001-

TOYOTA MOTOR SALES U.S.A., INC.

**'92 FUJITSU TEN 34210/34212 PIO/DIO CD PLAYER (CONT'D)**

Exchange CD players which have been countermeasured can be identified by a **RED MARK** next to the Serial Number on the bottom of the CD player. Fujitsu Ten started shipping countermeasured exchange CD players starting 6/92.

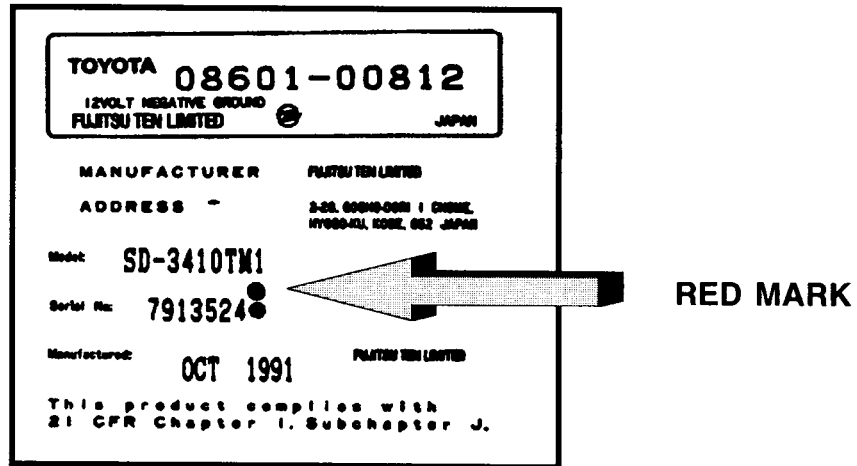

**RETURN EXCHANGED CD PLAYER AS SOON AS POSSIBLE.**