



Technical Service BULLETIN

February 16, 2001

Title:

POWER FRONT SEAT MOVEMENT/NOISE

Models:

'00 Avalon

T S B

BODY
B0005-01

Introduction Some 2000 model year Avalon customers may experience a squeak noise or slight movement from the front power seats. To improve this condition, production parts have been revised. Replace the seat adjuster assembly, with the current service part, for pre-countermeasure vehicles that exhibit this condition.

Applicable Vehicles

- 2000 model year **Avalon** vehicles.

Production Change Information


MODEL	STARTING VIN
2000 Avalon	4T1BF28B#YU097335

Parts Information

PREVIOUS PART NUMBER	CURRENT PART NUMBER	PART NAME
72010-AC030	Same	Power Adjuster Sub-Assembly, Front Seat, Outer RH
72010-AC040	Same	
72020-AC010	Same	Power Adjuster Sub-Assembly, Front Seat, Outer LH
72020-AC020	Same	
72020-AC030	Same	
72020-AC040	Same	

Repair Procedure

Replace the seat adjuster with the service part. Refer to the 2000 MY Avalon Repair Manual, pages BO-98 through BO-105.

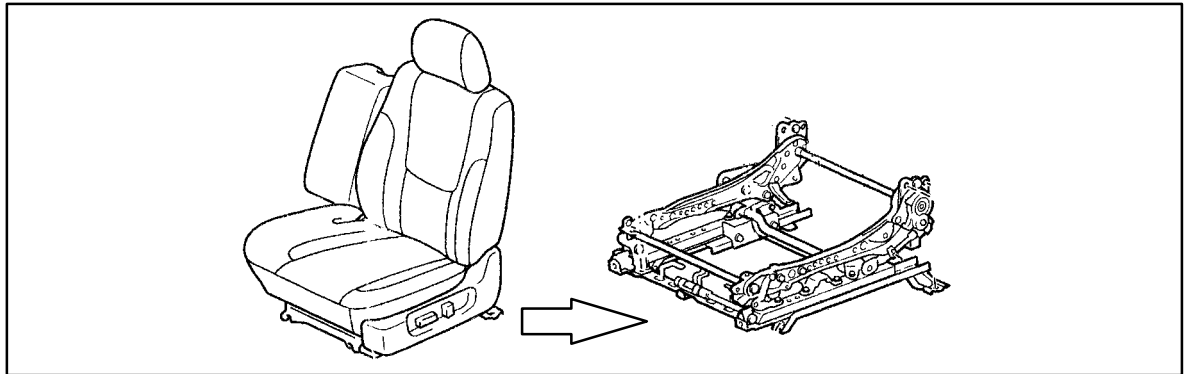

Warranty Information

OP CODE	DESCRIPTION	TIME	OPN	T1	T2
BD0057	R & R Seat Adjuster	1.3	720#0-AC0#0	91	43

Applicable Warranty*:

This repair is covered under the Toyota Comprehensive Warranty. This warranty is in effect for 36 months or 36,000 miles, whichever occurs first, from the vehicle's in-service date.

* Warranty application is limited to correction of a problem based upon a customer's specific complaint.

