

TOYOTA

SERVICE BULLETIN

TOYOTA MOTOR SALES, U.S.A., INC.

VOLUME

10

REFERENCE ELECTRICAL

NUMBER 008

DATE 09-14-90


MODEL SW

Page 1 of 1


DOM FUSE INSTALLATION DURING PDS ON '91 MR2

To reduce battery discharge during transportation and pre-delivery storage, all 1991 MR2s will be delivered to the dealer with the dome fuse (15A) removed. The dome fuse must be reinstalled during the pre-delivery service.

The dome fuse is located in Relay Block No. 5 in the front luggage compartment as shown.

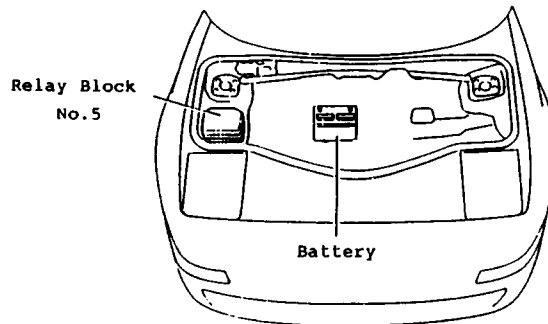

The 15A fuse is stored in Relay Block No. 5 during transportation. Reinstall the dome fuse in the location shown below.

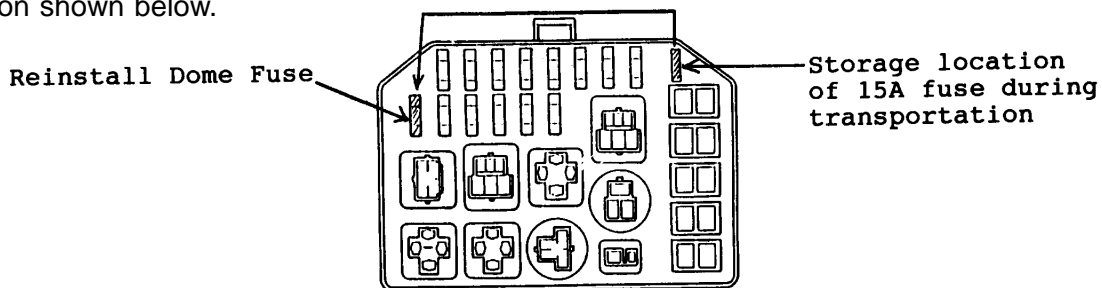

The following systems will be affected if the CIG Fuse is not installed:

FUZE		Affected Electrical System
Dome	15A	Interior Lights
		Clock
		Audio System
		Theft Deterrent Computer