

# TOYOTA

## SERVICE BULLETIN

TOYOTA MOTOR SALES, U.S.A., INC.

VOLUME

9


HEATING AND  
AIR CONDITIONING  
REFERENCE NUMBER 005  
DATE 01-08-88  
MODEL AE, EL, SV

Page 1 of 1


### RECEIVER DRIER INLET/OUTLET TUBE BOLT TORQUE

The torque specification for the inlet/outlet tube bolt for the receiver drier on Corolla, Tercel, and Camry in the 1988 Toyota Installation Manual CIAA-01 has been changed.

The installation Manual (CIAA-01) indicates the torque value for the inlet/outlet tube bolt should be 110 kg-cm (8 ft. lbs.). The torque value has been changed to 55 kg-cm (4 ft. lbs.) as follows:

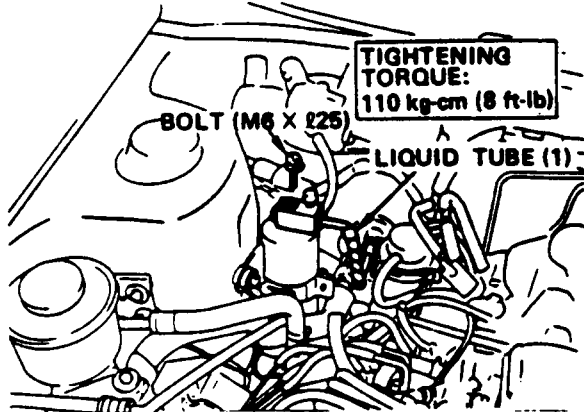

Incorrect Torque

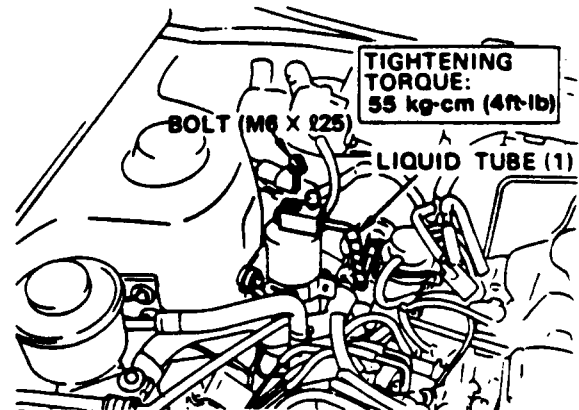

Corrected Torque