



**Technical Service
BULLETIN**

May 29, 1998

Title:
**TRAILER WIRE HARNESS
INSTALLATION NOTE**

Models:
'98 Land Cruiser

AX002-98
ACCESSORIES

Introduction The self tapping screws, placed in the trailer hitch cross tube to attach the wire harness bracket, require lubricant to prevent breaking during installation.

Affected Vehicles

- **Land Cruisers** from **1998** model year.

Parts Information


MODEL	NEW PART NUMBER	PART NAME
Land Cruiser	PT207-60980	Trailer Wire Harness

Required Materials

PART NUMBER	TOOLS & MATERIALS	QUANTITY
00530-1PL00	Toyota High Performance Lubricant or Equivalent	1

Repair Procedure

Spray lubricant in cross tube holes and then install mounting bracket with self-tapping screws.

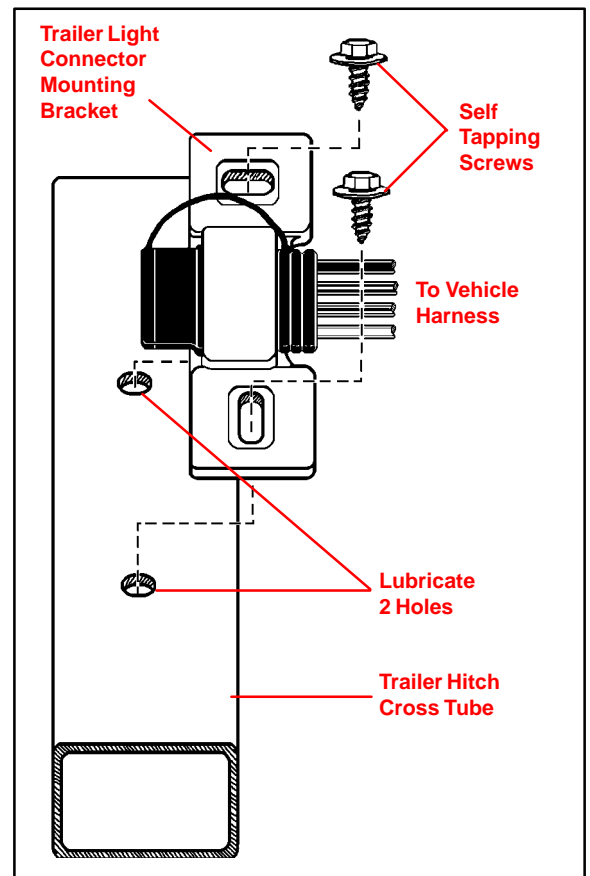

Warranty Information

OP CODE	DESCRIPTION	TIME	OPN	T1	T2
N/A	Not Applicable to Warranty	-	-	-	-



Toyota Supports ASE Certification