



Technical Service BULLETIN

May 2, 1997


Title:

A11712 FUJITSU TEN COMBO RADIO VOLUME CONTROL TOO SENSITIVE

Models:


'97 Camry

AUDIO
AU002-97

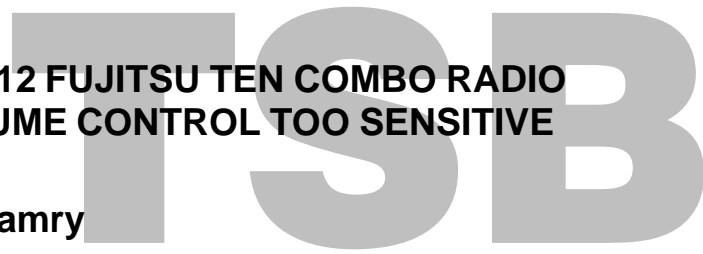

Introduction

The A11712 Fujitsu Ten Premium Combo Radio for the 1997 Camry was changed to reduce volume control sensitivity. This condition is caused by the mismatching of the signal level between the radio and the amplifier. The output voltage of the radio was reduced to improve this condition.

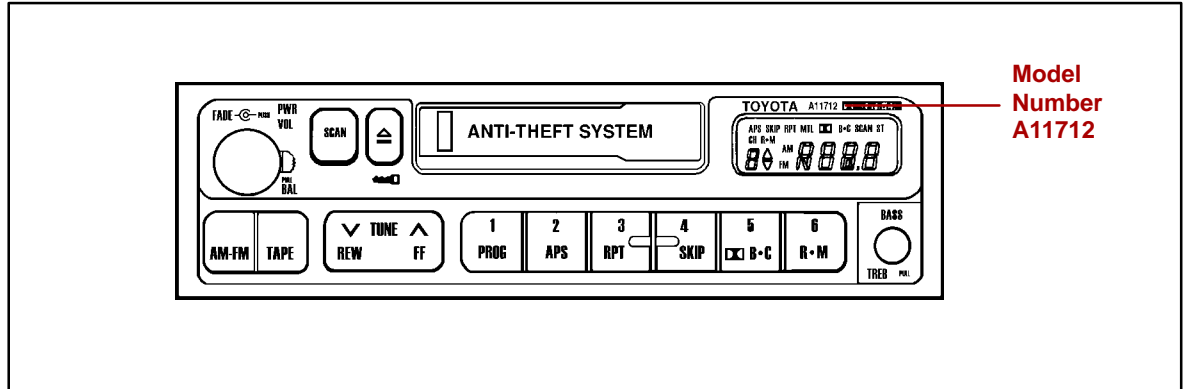

Product Change Information

- 1997 model year Camrys with radio serial numbers lower than 4324558 and/or VINs before:
 - 4T1BG * * * * VU084826
 - 4T1BF * * * * VU017815
 - 4T1BG * * * * VU777370
 - 4T1BF * * * * VU911942

Procedure

Exchange the Fujitsu Ten A11712 Radio to correct this condition. Fujitsu Ten began shipping countermeasured exchange radios starting in October 1996. Countermeasured radios have a green line on the right side of the chassis. These radios will also be in a blue plastic bag.

