



**Technical Service
BULLETIN**

January 28, 2004

Title:

CENTER REGISTER DISASSEMBLY PROCEDURE

Models:

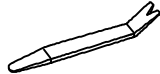

'00 – '04 Avalon

BODY
B0002-04

Introduction The center register removal procedure has been revised in order to prevent rattles, broken clips, and/or damage. Please follow the procedure below when removing the center register assembly.

- Applicable Vehicles**
- 2000 – 2004 model year **Avalon** vehicles.

Required SSTs

SPECIAL SERVICE TOOLS (SSTs)		PART NUMBER	QUANTITY
Plastic Pry Tool Set*		00002-06000-01	1
			

* Essential SSTs.

NOTE:
Additional SSTs may be ordered by calling SPX/OTC at 1-800-933-8335.

Warranty Information

OP CODE	DESCRIPTION	TIME	OFF	T1	T2
N/A	Not Applicable to Warranty	–	–	–	–



Repair Procedure

1. Insert plastic pry tool into location shown.

NOTE:
 Plastic pry tool must be used when removing the center register.

2. Pull straight out from the register assembly (take care not to pry in any direction other than straight outward, keep tool flat against register).

NOTE:

- **DO NOT PRY.**
- A significant amount of force is required to disengage register assembly.
- Pulling from top-center will allow bottom clips to release also.
- **DO NOT** pull/pry from any other area of register.
- Tool does **NOT** need to engage clip for release. Engagement with clip will only create more resistance for release.

