

## 2AZ-FE Throttle Body

**Service Category** Engine/Hybrid System

**Section** Engine Control

**Market** USA

Scion Supports  
 ASE Certification 

### Applicability

YEAR(S)	MODEL(S)	ADDITIONAL INFORMATION
2005 – 2010	tC	Engine(s): 2AZ VDS(s): DE167, DE177, DE3B7 WMI(s): JTK
2008 – 2010	xB	Engine(s): 2AZ VDS(s): KE50E, ZE4FE WMI(s): JTL

### Introduction

The purpose of this TSB is to provide updated throttle body part number information for certain vehicles equipped with the 2AZ-FE engine. The drain pipe has been eliminated on throttle body service parts. Please use the information below when replacing the throttle body assembly.

### Warranty Information

OP CODE	DESCRIPTION	TIME	OFF	T1	T2
N/A	Not Applicable to Warranty	–	–	–	–

### Parts Information


MODEL	MODEL YEAR	PREVIOUS PART NUMBER	CURRENT PART NUMBER	PART NAME	QTY
tC	2005–2006	22030-0H020 22030-28060	22030-0H021	Body Assy, Throttle w/Motor	1
	2007–2010	22030-0H030 22030-28070	22030-0H031		1
xB	2008–2010	22030-0H030 22030-28070	22030-0H031		1

## 2AZ-FE Throttle Body

### Repair Procedure

When replacing the throttle body assembly, remove and discard the throttle body hose that no longer has a port on the throttle body assembly. The port connected to the other end of the throttle body hose can be left open to the atmosphere — it does NOT need to be sealed.

**Figure 1. Previous Throttle Body Assembly**

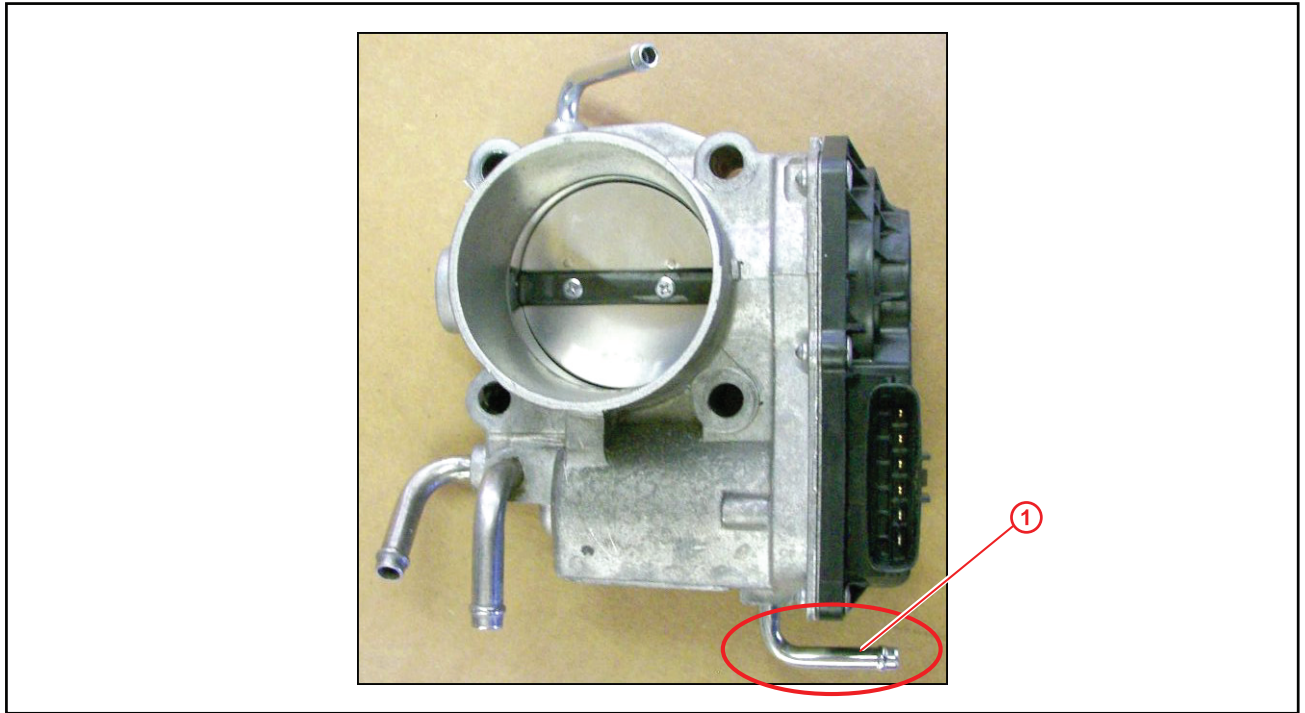

<b>1</b>	This Port NOT on New Service Part
----------	-----------------------------------