

TOYOTA

SERVICE BULLETIN

TOYOTA MOTOR SALES, U.S.A., INC.

VOLUME

9

Transmission
& Clutch

REFERENCE _____
NUMBER 009
DATE 03-11-88
MODEL MR2 (AW),
Corolla (AE)


Page 1 of 2



A240 B2 DISC AND PLATE MODIFICATION TO REDUCE SHIFT SHOCK

To reduce the shift shock levels on MR2's and Corolla's equipped with A240 automatic transaxles the following changes have been made.


1. Friction material of B2 disc has been changed.
2. The number and order of B2 disc and plates has been changed. (See illustration)
3. B2 Accumulator Piston Spring has been changed.

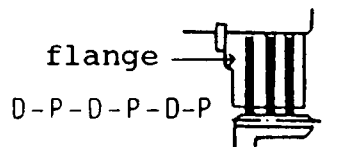

PREVIOUS



	disc	3 pieces
	plate	3 pieces

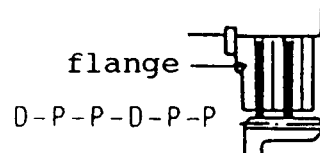
NEW



	disc	2 pieces
	plate	4 pieces

D: Disc

P: Plate

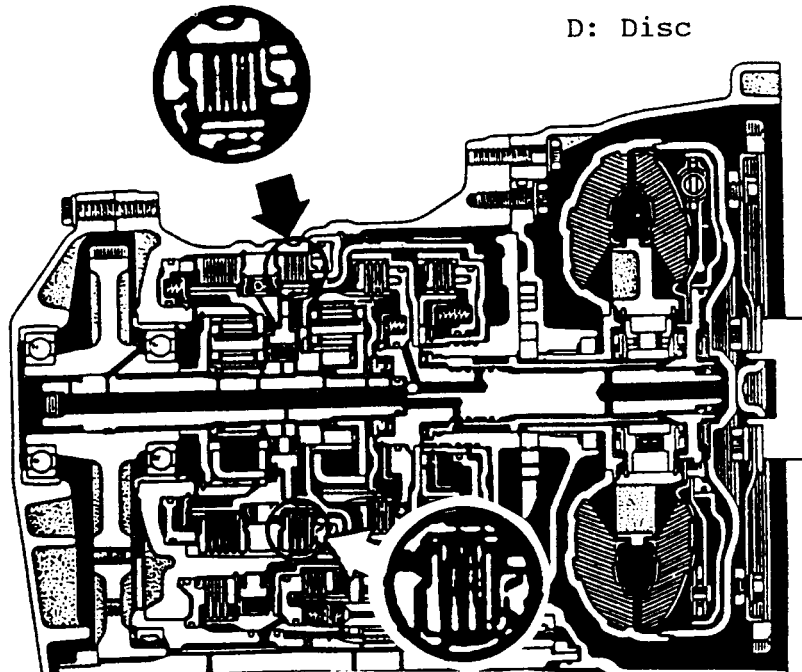

A240 B2 DISC AND PLATE MODIFICATION TO REDUCE SHIFT LICK

PRODUCTION EFFECTIVE:

<u>FROM FRAME #</u>	<u>FROM TRANS NO.</u>	<u>FROM PRODUCTION DATE</u>
JT2AW1##G0065249	6AZ-00972	January 1986
JT2AE8#E#G3333682	6AZ-00972	January 1986

PART NUMBER INFORMATION:

<u>PREVIOUS PART #</u>	<u>Q'ty</u>	<u>NEW PART #</u>	<u>Q'ty</u>	<u>PART NAME</u>
35677-12010	3	*35677-20020	2	Disc, Clutch (For 2nd Brake)
35648-32010	3	*SAME	4	Plate, Clutch (For 2nd Brake)
90501-25011	1	*90501-26014	1	Spring (B2 Accumulator Piston)

*** PARTS ARE INTERCHANGEABLE AS A SET ONLY**