



**Technical Service  
BULLETIN**

August 15, 2007

Title:  
**ACCESS DOOR WATER LEAK**  
Models:  
**'07 FJ Cruiser**

**TSB**

**BODY**  
**B0007-07**

**Introduction** Some customers may complain that the access door jamb is wet. The access door weatherstrip has been modified to prevent water from entering the door and dripping on the floor. Follow the repair procedure in this TSB to replace the access door weatherstrip.

- Applicable Vehicles**
- **2007** model year **FJ Cruiser** vehicles produced **BEFORE** the Production Change Effective VINs shown below.

**Production Change Information**

MODEL	PRODUCTION CHANGE EFFECTIVE VIN
FJ Cruiser	JTEZU11F670007044
	JTEBU11F570042501

**Parts Information**

PREVIOUS PART NUMBER	CURRENT PART NUMBER	PART NAME	QTY
67871-35070	67871-35071	Weatherstrip, Access Panel, RH	1
67872-35070	67872-35071	Weatherstrip, Access Panel, LH	1

**Warranty Information**

OP CODE	DESCRIPTION	TIME	OFF	T1	T2
671361	R & R Access Door Weatherstrip (One Side)	0.4	67871-35070 67872-35070	66	14
Combo A	Opposite Side	0.2			



**Applicable Warranty\*:**

**This repair is covered under the Toyota Comprehensive Warranty. This warranty is in effect for 36 months or 36,000 miles, whichever occurs first, from the vehicle's in-service date.**

\* Warranty application is limited to correction of a problem based upon a customer's specific complaint.



Required  
Tools &  
Equipment

ITEM NO.	SPECIAL SERVICE TOOLS (SSTs)	PART NUMBER	QTY	DRW**
1	Plastic Pry Tool Set*	00002-06000-01	1	20
COMPONENT(S) OF KIT/SET	<p>NOTE:</p> <ul style="list-style-type: none"> <li>All components from this kit/set are required.</li> <li>Plastic Panel Clip Removal Tool (P/N 00002-06001-01) </li> <li>Plastic Emblem Removal Tool (P/N 00002-06002-01) </li> </ul>			


\* Essential SSTs.

\*\* Drawer number in SST Storage System.

**NOTE:**  
Additional SSTs may be ordered by calling SPX/OTC at 1-800-933-8335.


**Repair Procedure**

1. Remove the access panel weatherstrip.
  - A. Disengage the 7 push clips.

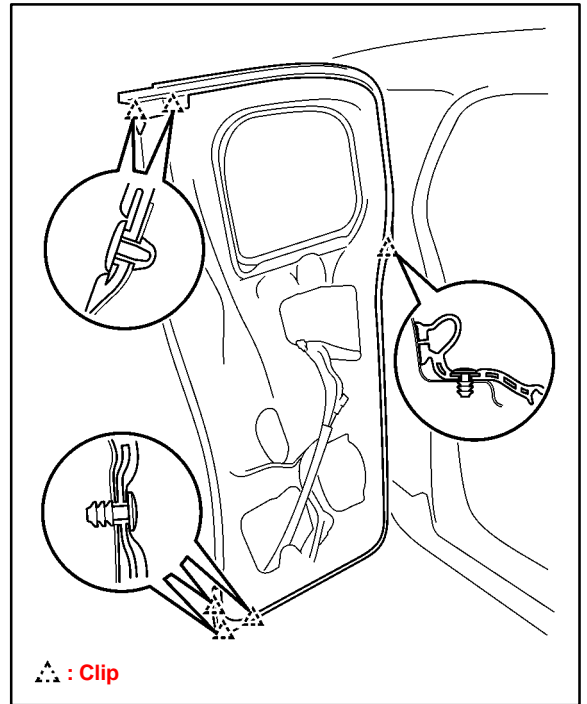


- B. Using the plastic panel clip removal tool, disengage the 19 clips on the weatherstrip.

**NOTE:**  
Remove any tape remaining on the door side.

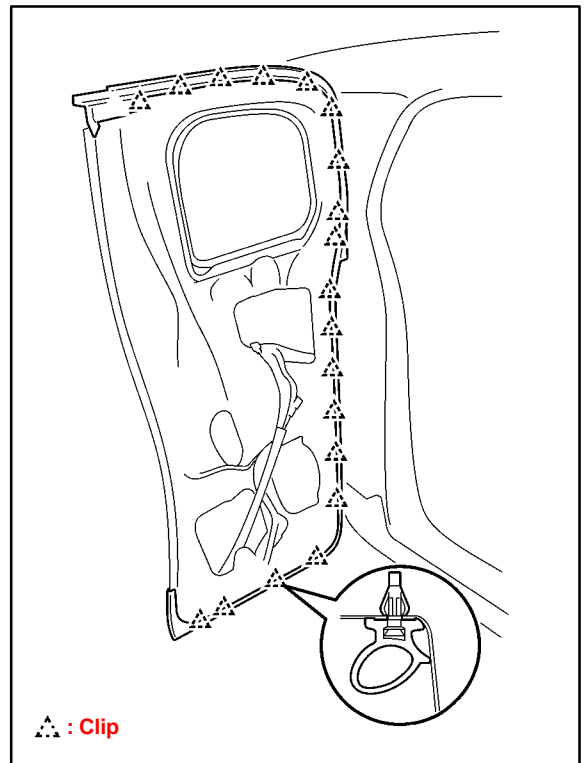

**Repair  
Procedure**  
(Continued)

2. Install the access panel weatherstrip using the NEW service parts.
  - A. Clean the door surface where the double-sided tape is applied.
  - B. Engage the 19 clips.
  - C. Push firmly on the weatherstrip to ensure the double-sided tape makes good contact with the door frame.

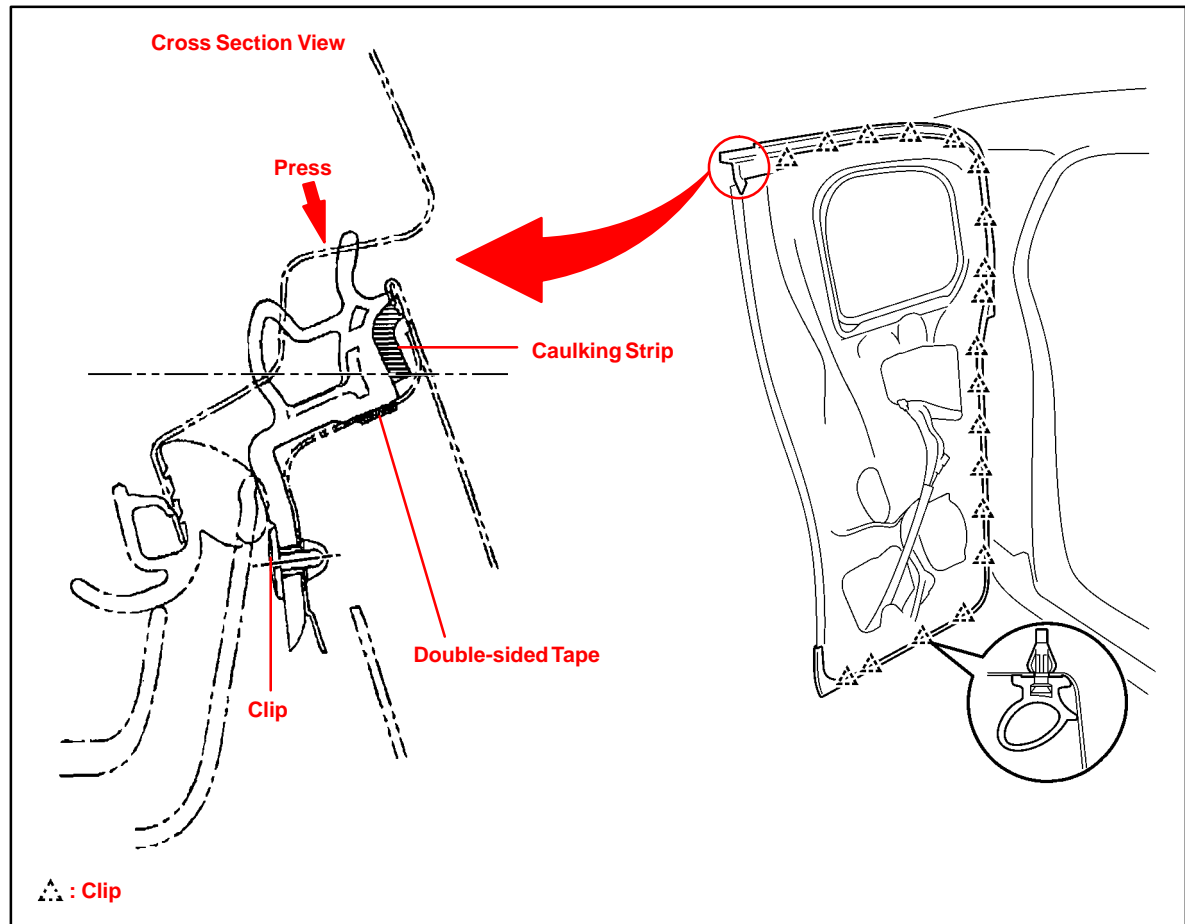

**Repair  
Procedure**  
(Continued)

D. Engage the 7 push clips.

