



TECHNICAL SERVICE BULLETIN

REF.: HEATING & AIR CONDITIONING

NO.: AC001-96

DATE: MAY 17, 1996

MODEL: AVL

AMBIENT TEMPERATURE DISPLAYS -22°F

Page 1 of 1

On Avalon models equipped with an ambient temperature display, -22°F may appear in the ambient temperature display if continuity through the ambient temperature sensor circuit is interrupted. Since the -22°F is retained in memory, the condition will persist even after continuity through the ambient temperature sensor circuit has been reestablished. Climate control system operation may also be adversely affected.


This condition can be corrected by briefly removing the fuse supplying the B+ power source to the A/C amplifier.

Do not attempt repairs before performing the following reset procedure:

RESET PROCEDURE:

Remove the following fuse for 30 seconds and reinstall (see illustration):

Fuse	Junction Block	Location
ECU-B	Engine Room (#2)	Left Engine Compartment

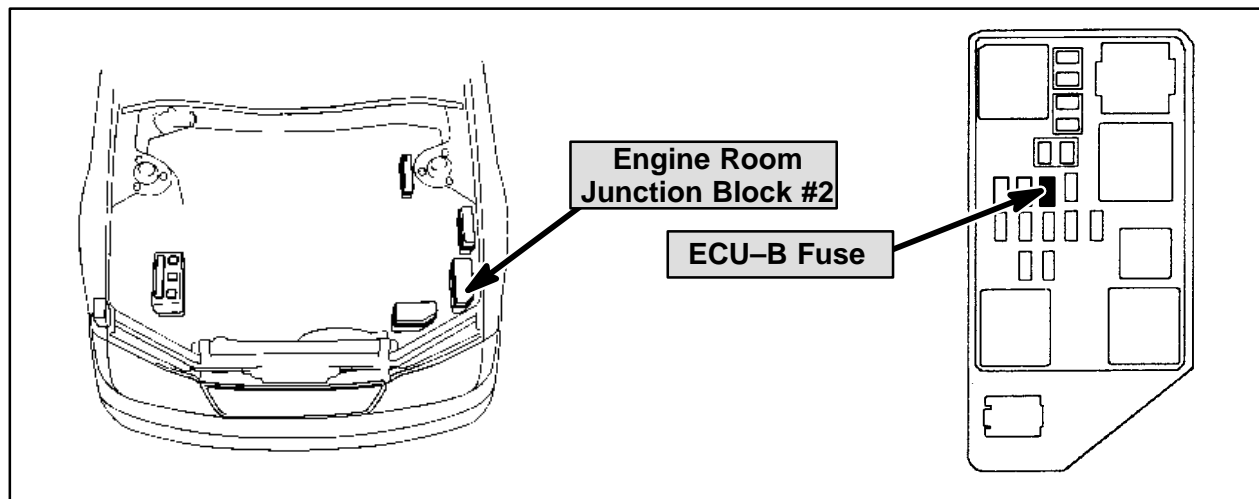

If ambient temperature display is not corrected, refer to repair manual for diagnosis.