



Technical Service BULLETIN

April 22, 2004

Title: **AUDIO SYSTEM MUTED AFTER ENDING BLUETOOTH WIRELESS PHONE CALL**

Models: '04 Land Cruiser

AUDIO
AU003-04

Introduction Some customers may experience no sound when turning on the audio system after ending a phone call using the Bluetooth system when the radio is off during the phone call. Improvements have been made to the software inside the audio head unit to remedy this condition.

- Applicable Vehicles**
- **2004** model year **Land Cruiser** vehicles equipped with the **Toyota Navigation System** produced **BEFORE** the Production Change Effective VIN shown below.


Production Change Information

MODEL	PRODUCTION CHANGE EFFECTIVE VIN
Land Cruiser	JTEHT05J*42061090

Parts Information

PREVIOUS PART NUMBER	CURRENT PART NUMBER	PART NAME	QTY
86120-60602	Same	Receiver Assembly, Radio	1

Parts Identification The updated parts will have a 2 digit number (01 or 02) after the Toyota part number on the tag on the bottom surface of the head unit.

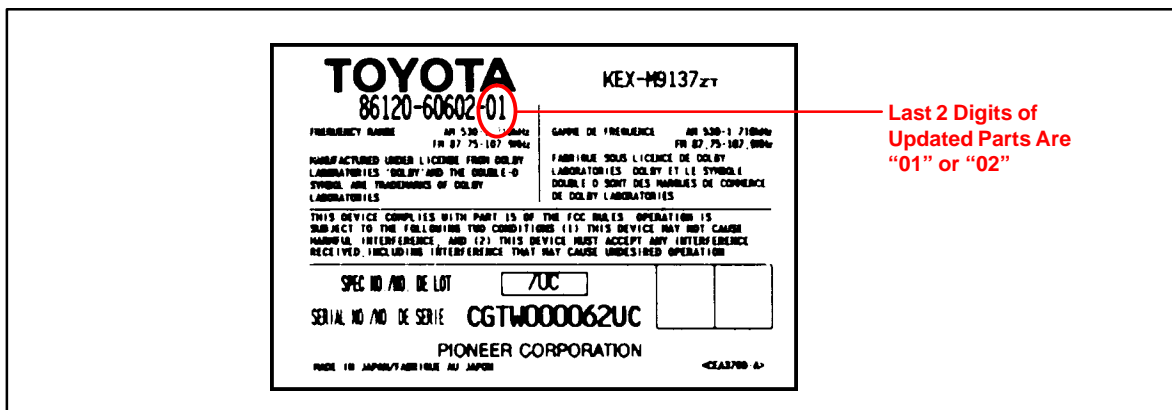

Repair Procedure Order a replacement radio head unit from Pioneer through the exchange program by calling 1-800-553-3756.

Warranty Information

OP CODE	DESCRIPTION	TIME	OFF	T1	T2
860031	R & R Radio Receiver Assembly	0.2	86120-60602	72	74

Applicable Warranty*:
 This repair is covered under the Toyota Comprehensive Warranty. This warranty is in effect for 36 months or 36,000 miles, whichever occurs first, from the vehicle's in-service date.

* Warranty application is limited to correction of a problem based upon a customer's specific complaint.

