

TOYOTA

SERVICE BULLETIN

TOYOTA MOTOR SALES, U.S.A., INC.

VOLUME

10

REFERENCE AUDIO

NUMBER 004 (REVISED)

DATE 04-14-89

MODEL 89 AE, EL, SV/VV,
ST, YR, RN, VN, FJ

Page 1 of 2

AUTO REVERSE CASSETTE (P/N 08690-00810) MODEL 5906 INSTALLATION

SERVICE TIP

During the initial installation of a model 5906 (P2) Auto-reverse cassette deck (P/N 08690-00810), the 13 pin DIN connector may not lock properly into the following radio models:

- Factory AM/FM ETR model numbers 1432 & A1432 (ER).
- PIO AM/FM ETR model numbers 1433 & A1433 (R2).

MODEL APPLICATION INFORMATION:

FACTORY AM/FM ETR

Model # 1432, A1432

Celica
Corolla (CPE)
Tercel
Van
Truck/4Runner

PIO AM/FM ETR

Model # 1433, A1433

Tercel
Corolla
Camry
Van
Truck/4Runner

INSTALLATION PROCEDURE CHANGE:

An adapter cable (P/N 00233-00802) is now required to ensure proper locking of the DIN connector.

NOTE: Corolla Sedan does not require the adapter cable due to the proximity of the Radio head unit to deck.

Once connections have been made, use a plastic tie strap or electrical tape to fasten the 13 pin DIN connector adapter cable to the vehicle wire harness (see figure on page 2).

ADDITIONAL NOTE: This change in procedure only affects the 08690-00810 deck.


AUTO REVERSE CASSETTE (P/N 08690-00810) MODEL 5906 INSTALLATION

FIELD FIX PROCEDURE

Due to the possibility of improper locking of the DIN connector, there is the chance for a loose connection on units installed prior to this notice. If this occurs, the radio and cassette deck units will become inoperative.

If you encounter this problem, use the following steps:

- 1) Verify that the applicable radio and cassette deck units are installed (ie., model 1432, A1432, 1433, or A1433 AM/FM ETR with model 5906 Cassette Deck).
- 2) Install adapter cable P/N 00233-00802 as shown on the figure below.

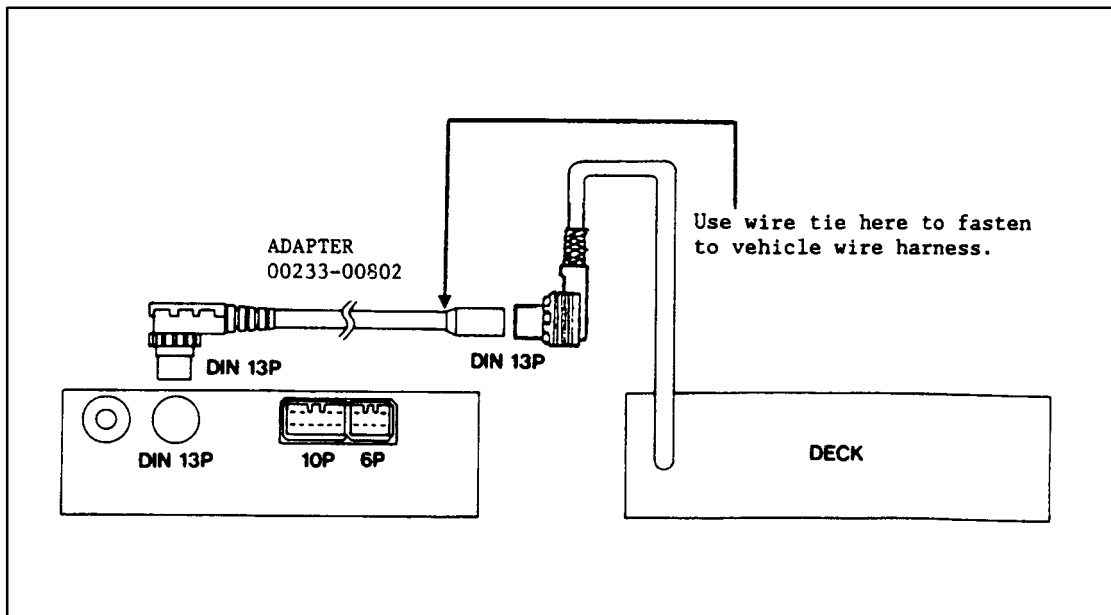

NOTE: For instructions on warranty time, refer to Warranty Bulletin #89-12.