



**Technical Service  
BULLETIN**

June 16, 2006

Title:

**FRONT SEAT TRACK SQUEAK**

Models:

'03 – '06 4Runner



NV005-06

H/V

**TSB UPDATE NOTICE:**

The information contained in this TSB supercedes TSB No. NV001-03. TSB No. NV001-03 is now obsolete and should be discarded.

**Introduction** Some customers may experience a squeak/creak noise from the front driver or passenger's seat tracks. The following procedure was developed to reduce the noise.

- Applicable Vehicles**
- 2003 – 2006 model year 4Runner vehicles.

**Parts Information**

PREVIOUS PART NUMBER	CURRENT PART NUMBER	PART NAME	QTY
71120-35020	Same	Front Seat Adjuster Sub-assembly	1

**Required Tools & Material**

TOOLS & MATERIAL	PART NUMBER	QUANTITY
Aerosol Spray Type White Grease (or equivalent)	00289-1WG00	1

**Warranty Information**

OP CODE	DESCRIPTION	TIME	OFP	T1	T2
BD1063	R & R Seat Track Covers (1 Seat — 4 Track Covers)	0.1	71120-35020	91	99
Combo A	Apply White Grease to Seat Tracks (8 Apply Areas)	0.1			

**Applicable Warranty\*:**


This repair is covered under the Toyota Comprehensive Warranty. This warranty is in effect for 36 months or 36,000 miles, whichever occurs first, from the vehicle's in-service date.

\* Warranty application is limited to correction of a problem based upon a customer's specific complaint.



**Repair  
Procedure**


1. Remove seat track covers.

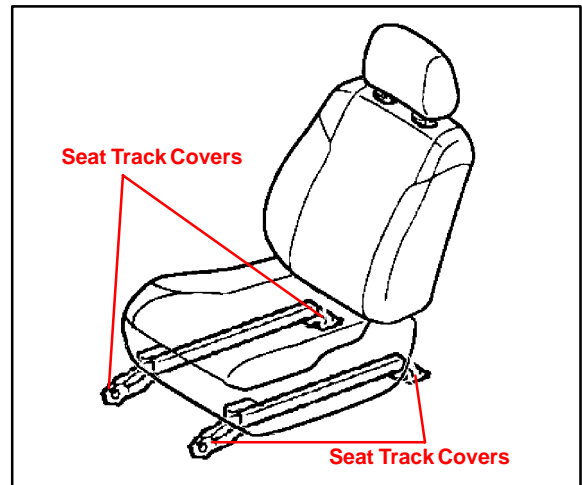

2. Apply aerosol spray type white grease between the seat track rail and bracket as shown.

**NOTE:**

- When applying lubricant to the seat track, cover the carpet with paper or sheet plastic to protect from overspray.
- There are a total of 8 apply areas — 2 at the front and 2 at the rear of each of the two seat tracks.

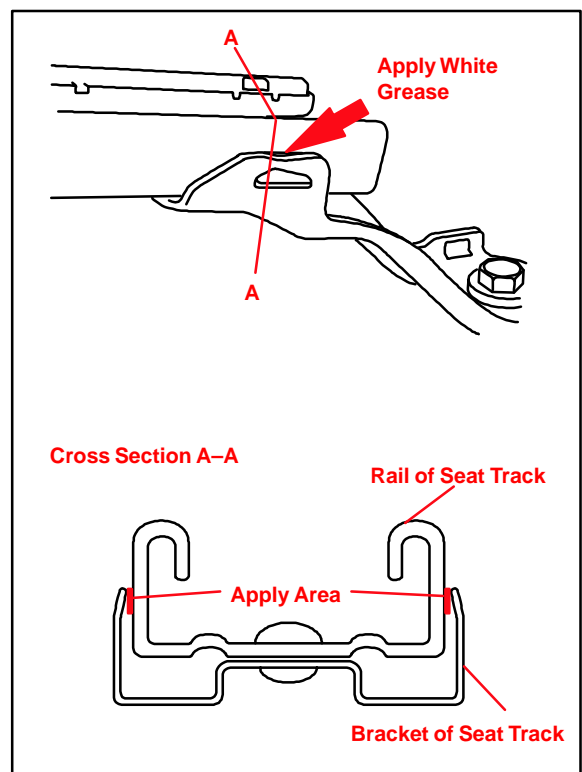

3. Reinstall seat track covers.