



**Technical Service
BULLETIN**

August 8, 2006

Title:

POP NOISE ON FM RADIO STATIONS

Models:

'06 4Runner



**Audio
AU003-06**

Introduction On 2006 model year 4Runner vehicles equipped with either the base audio system or the navigation system, some customers may experience a condition where there are abnormal pop noises on some FM radio stations. An improved radio receiver has been developed to correct this condition.

Applicable Vehicles

- **2006** model year **4Runner** vehicles equipped with the **base audio system** or the **navigation system** and produced **BEFORE** the Production Change Effective VINs shown below.

Production Change Information

MODEL	PLANT	PRODUCTION CHANGE EFFECTIVE VIN
4Runner	Tahara	JTE**14R#60079691
	Hino	JTE**14R#68073842

Parts Information

PREVIOUS PART NUMBER	CURRENT PART NUMBER	PART NAME	QTY
86120-52530	Same	Radio Assembly	1
86120-35390	Same	Navigation Receiver Assembly	1

Warranty Information

OP CODE	DESCRIPTION	TIME	OFP	T1	T2
860031	R & R Radio Receiver Assembly	0.5	86120-52530 86120-35390	91	74

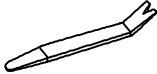

Applicable Warranty*:

This repair is covered under the Toyota Comprehensive Warranty. This warranty is in effect for 36 months or 36,000 miles, whichever occurs first, from the vehicle's in-service date.

* Warranty application is limited to correction of a problem based upon a customer's specific complaint.



Required
SSTs

ITEM NO.	SPECIAL SERVICE TOOLS (SSTs)	PART NUMBER	QTY	DRW**
1	Plastic Pry Tool Set*	00002-06000	1	20
COMPONENT(S) OF KIT/SET	NOTE:			
	<ul style="list-style-type: none"> All components from this kit/set are required. Plastic Panel Clip Removal Tool (P/N 00002-06001-01)  Plastic Emblem Removal Tool (P/N 00002-06002-01)  			

* Essential SSTs.

** Refers to drawer number in SST Storage System.

NOTE:

Additional SSTs may be ordered by calling SPX/OTC at 1-800-933-8335.

Repair
Procedure

1. **With base audio system:** Order a replacement radio through the Fujitsu-Ten exchange program. (Refer to Warranty Policy Handbook for contact information.)

With navigation system: Order a replacement navigation receiver through the Denso exchange program. (Refer to Warranty Policy Handbook for contact information.)

2. Replace the radio receiver or navigation receiver.

Refer to the Technical Information System (TIS), 2006 model year 4Runner Repair Manual: *Audio & Video System: Radio Receiver Assy: Replacement.*