

TOYOTA

SERVICE BULLETIN

TOYOTA MOTOR SALES, U.S.A., INC.

VOLUME

9

REFERENCE	ENGINE
NUMBER	008
DATE	12-11-87
MODEL	AW16

Page 1 of 1

SUPERCHARGED MR2 FUEL INJECTORS

The following special service procedures must be observed when replacing fuel injectors on supercharged MR2 engines (4A-GZE).


- Fuel Injectors are color coded according to flow rate and matched to the engine at the assembly plant.

Note: All four injectors installed on the engine must be of the same color coding.

- If replacement is necessary, replace with only an injector of the same color coding as that originally installed.

(Example, four yellow coded injectors cannot be substituted for four black coded injectors.)

- Location of injector color mark is shown in the accompanying illustration.

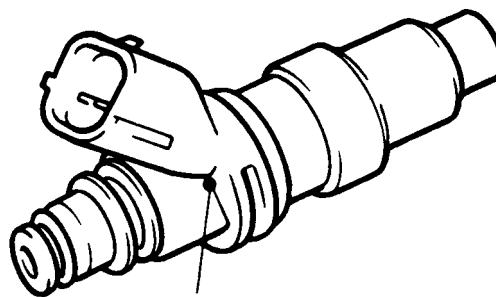

Position of colored mark

- Individual part numbers for injectors are as follows:

23209-16060 - 01 = Blue
23209-16060 - 02 = Black
23209-16060 - 03 = Yellow
23209-16060 - 04 = White