



**Technical Service
BULLETIN**

June 4, 2003

Title:


**BLANK MAP SCREEN IN
NAVIGATION SYSTEM**

Models:

All '03 Models With Navigation System

**ELECTRICAL
EL009-03**

Introduction In some cases, when a vehicle arrives at a U.S. or Canadian port, and/or is in new inventory at the dealer, a blank map screen may occur, as shown below, just after turning the ignition switch ON and then touching the "I agree" switch. The only items that can be seen are the touch switches, compass, and the vehicle icon.

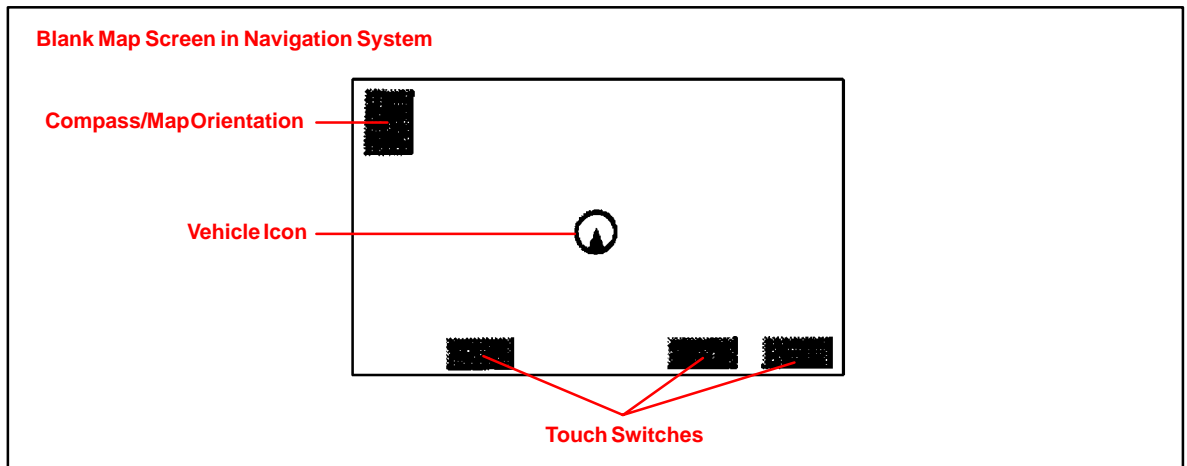

This condition is not a system failure. This is due to the system position memory originally identifying a set location near the manufacturing plant in Japan when the vehicle is brand-new. To re-initialize the navigation system memory location, follow the instructions on page 2.

**Applicable
Vehicles**

- All 2003 model year **Toyota** vehicles with **Navigation System**.

**Warranty
Information**

OP CODE	DESCRIPTION	TIME	OFF	T1	T2
N/A	Not Applicable to Warranty	-	-	-	-



Repair Procedure

Follow the flow chart below to fix the blank map screen condition.

