

TOYOTA

SERVICE BULLETIN

TOYOTA MOTOR SALES, U.S.A., INC.

VOLUME

10

REFERENCE BRAKES

NUMBER 006



DATE 08-10-90

MODEL MX8#

Page 1 of 1

PARKING BRAKE SHOE HOLD DOWN SPRING

To eliminate noise from the parking brake shoe when driving over rough surfaces, the hold down spring for the rear side of the shoe assembly has been changed. The new spring increases the holding force against the shoe.

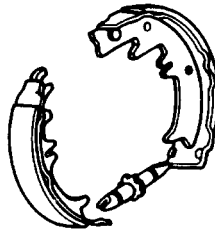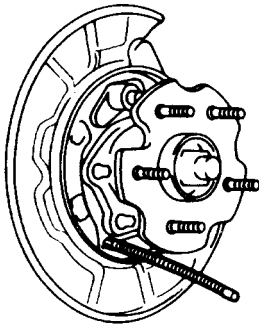

Rear side
New P/N 90501-16053

Front side
P/N 90501-14049

PRODUCTION EFFECTIVE:

From VIN
JT2MX83E#L0007536

P/D
12/89

PART NUMBER INFORMATION:

Prev. Part No.
90501-14049

New Part No.
90501-16053

Part Name
Rear Side
Spring, Compression
Front Side
Spring, Compression

90501-14049

NO CHANGE